




Dimensions for series

ZX-Ø-K

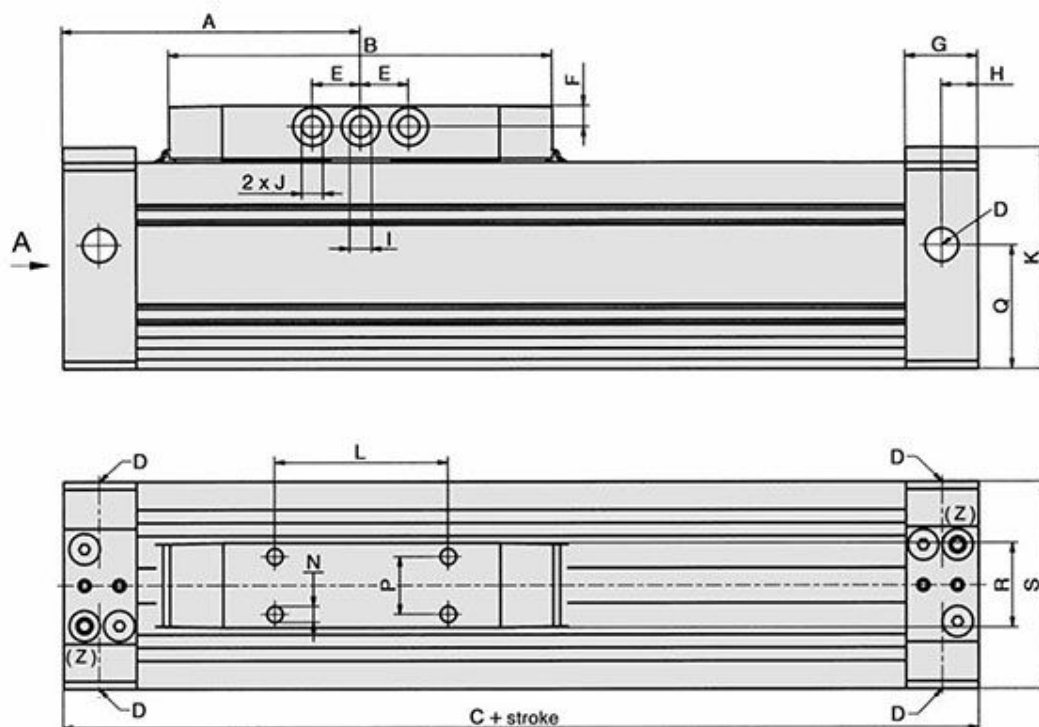

cross section B-B

SA = Depth of thread
SB = Length of hex.

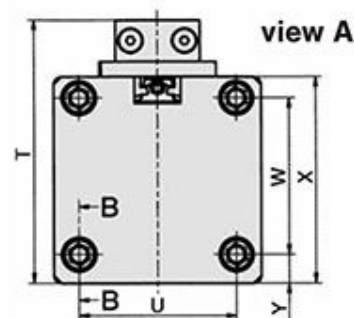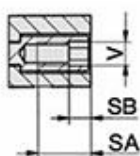

(Z) = Cushion set screw.

Drawing shows pressure supply type -01 for air connection on both ends.
Other types see page 9.156.

Piston-Ø	A	B	C	D	E	F	G	H	I	J	K	L
25	67.5	84.6	135	G 1/8	12.5	5	19	9.5	6 H7	4.5	49	35
32	77.5	99.6	155	G 1/8	12.5	5.5	19	9.5	6 H7	5.5	58	45
40	95	112.6	190	G 1/4	12.5	7	23	11.5	7 H7	6.5	68	50
50	105	122	210	G 3/8	17.5	9	30	17	10 H7	8.5	94	64
63	125	150	250	G 3/8	25	9.5	30	17	10 H7	8.5	110	80

Piston-Ø	N	P	Q	R	S	T	U	V	W	X	Y	SA	SB
25	M5 x 7 mm deep	15	25	22	45	60	36	M4	36	45	4.5	11	3
32	M5 x 7 mm deep	15	32.3	22	54	69	41	M5	41	54	7.5	11	4
40	M5 x 9 mm deep	15	38.3	22	64	82	49	M6	49	64	7.5	12	4
50	M8 x 16 mm deep	34	59	46	90	115	65	M8	65	90	12.5	17	5
63	M8 x 16 mm deep	34	68.4	46	106	131	78	M8	78	106	14	17	5