



Dimensions for series

ZX-Ø-KG

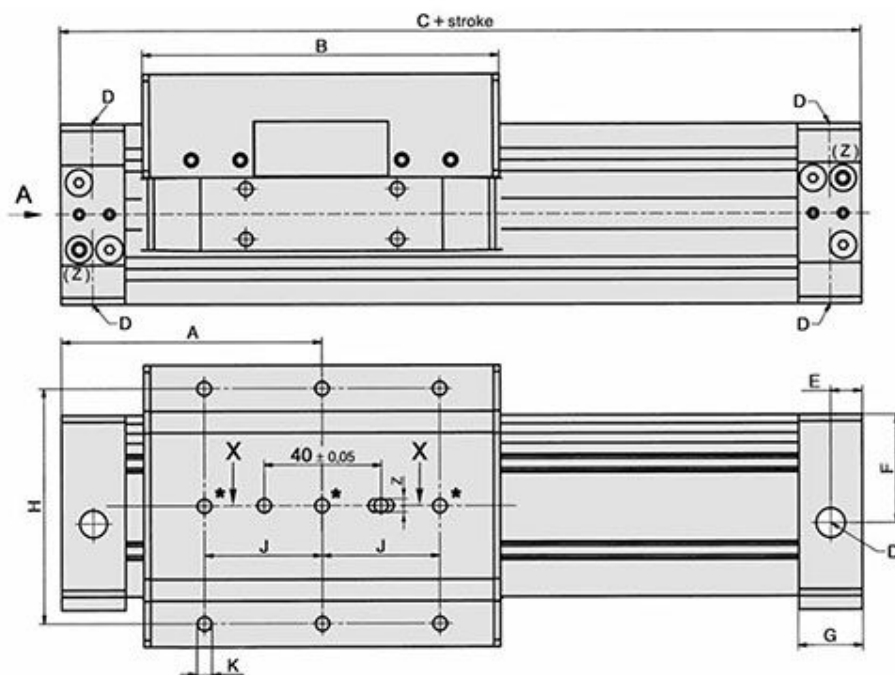


cross section B-B

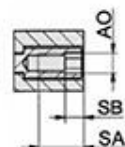


SA = Depth of thread
SB = Length of hex.

cross section X-X

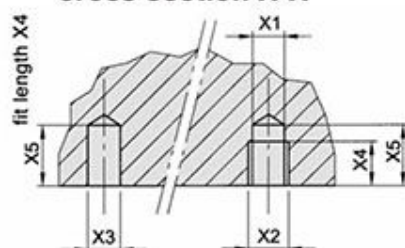

view A

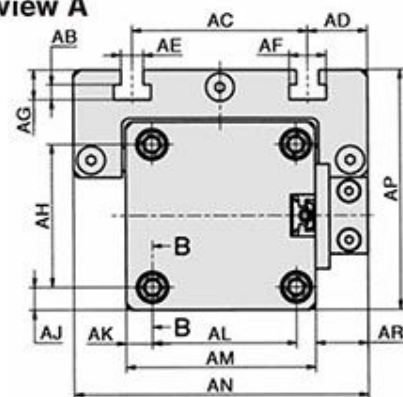

* = Thread only in cylinder $\varnothing$ 32 mm (depth of thread 9 mm).
(Z) = Cushion set screw.

Drawing shows pressure supply type -01 for air connection on both ends.
Other types see page 9.156.

Piston-Ø	A	B	C	D	E	F	G	H	J	K	AB	AC	AD	AE	AF	AG
25	67.5	94	135	G 1/8	9.5	25	19	30	30	M5 x 8 mm deep	4.3	50	12.5	6.4	10.4	8.6
32	77.5	106	155	G 1/8	9.5	32.3	19	70	35	M5 x 11 mm deep*	4.3	50	16.9	6.4	10.4	8.6
40	95	136	190	G 1/4	11.5	38.2	23	55	55	M6 x 12 mm deep	4.3	80	10	6.4	10.4	8.6
50	105	148	210	G 3/8	17	59	30	42	50	M8 x 16 mm deep	4.3	94	23	6.4	10.4	8.4
63	125	180	250	G 3/8	17	68.4	30	60	60	M8 x 16 mm deep	4.3	110	24	6.4	10.4	8.4

Piston-Ø	AH	AJ	AK	AL	AM	AN	AO	AP	AR	SA	SB	Ø X1	X2	Ø X3	X4	X5	Z
25	36	4.5	4.5	36	45	75	M4	59	15	11	3	4	4.4 ± 0.2	4 H7	4.5	5.5	4 ± 0.02
32	41	6.5	7.5	41	54	83.8	M5	69	15	11	4	4	4.4 ± 0.2	4 H7	7	8	4 ± 0.02
40	49	7.5	7.5	49	64	100	M6	79	18	12	4	6	6.4 ± 0.2	6 H7	7	8	6 ± 0.02
50	65	12.5	12.5	65	90	133	M8	112.5	25	17	5	-	6.4 ± 0.2	6 H7	3	3	6 ± 0.02
63	78	14	14	78	106	150	M8	134.5	26	17	5	-	6.4 ± 0.2	6 H7	6.5	6.5	6 ± 0.02