


Rodless cylinders


Dimensions for series

ZX-Ø-S

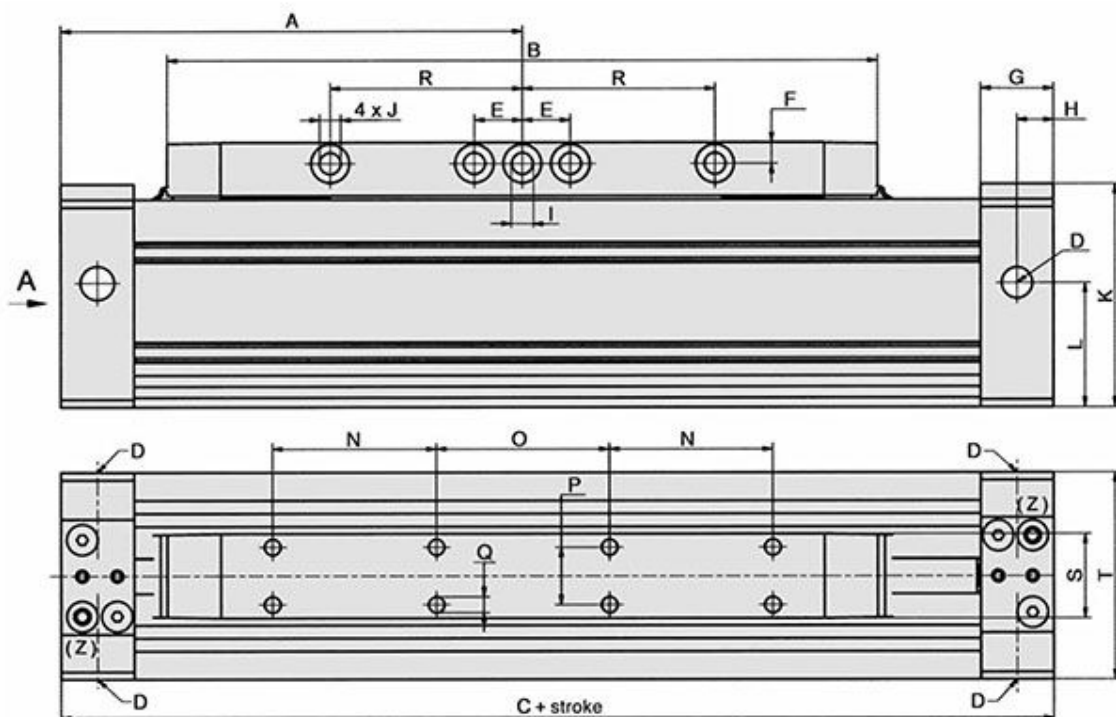


cross section B-B

SA = Depth of thread
SB = Length of hex.

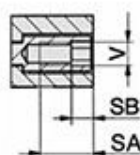

view A

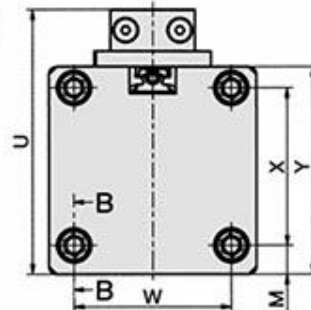

(Z) = Cushion set screw.

Drawing shows pressure supply type -01 for air connection on both ends.

Other types see page 9.156.

Piston-Ø	A	B	C	D	E	F	G	H	I	J	K	L	M	N
25	100	149.6	200	G 1/8	12.5	5	19	9.5	6 H7	4.5	49	25	4.5	20
32	120	184.5	240	G 1/8	12.5	5.5	19	9.5	6 H7	5.5	58	32.3	7.5	42.5
40	150	222.6	300	G 1/4	12.5	7	23	11.5	7 H7	6.5	68	38.2	7.5	35
50	175	262	350	G 3/8	17.5	9	30	17	10	8.5	94	59	12.5	45
63	200	300	400	G 3/8	25	9.5	30	17	10	8.5	110	68.4	14.0	80

Piston-Ø	O	P	Q	R	S	T	U	V	W	X	Y	SA	SB
25	50	15	M5 x 7 mm deep	35	22	45	60	M4	36	36	45	11	3
32	45	15	M5 x 7 mm deep	50	22	54	69	M5	41	41	54	11	4
40	90	15	M5 x 9 mm deep	65	22	64	82	M6	49	49	64	12	4
50	60	34	M8 x 16 mm deep	90	46	90	115	M8	65	65	90	17	5
63	80	34	M8 x 16 mm deep	90	46	106	131	M8	78	78	106	17	5