



Dimensions for series

ZX-Ø-SG

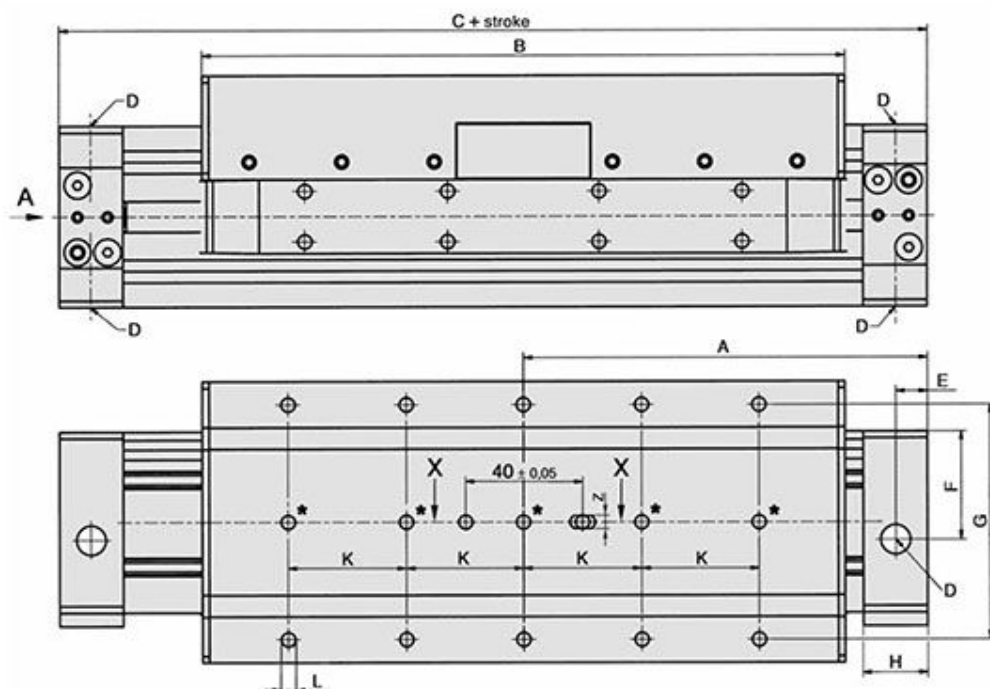


cross section B-B

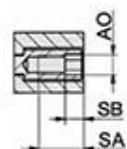


SA = Depth of thread
SB = Length of hex.

cross section X-X

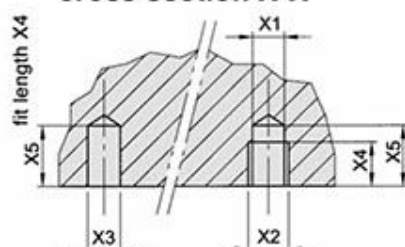

view A

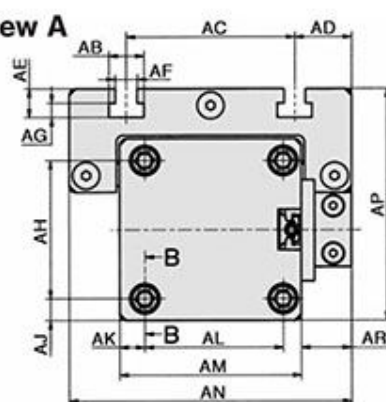

* = Thread only in cylinder $\varnothing$ 32 mm (depth of thread 9 mm).

(Z) = Cushion set screw.

Drawing shows pressure supply type -01 for air connection on both ends.
Other types see page 9.156.

Piston-Ø	A	B	C	D	E	F	G	H	K	L	AB	AC	AD	AE	AF	AG
25	100	159	200	G 1/8	9.5	25	30	19	30	M5 x 8 mm deep	10.4	50	12.5	8.6	6.4	4.3
32	120	191	240	G 1/8	9.5	32.3	70	19	35	M5 x 11mm deep*	10.4	50	16.9	8.6	6.4	4.3
40	150	246	300	G 1/4	11.5	38.2	55	23	55	M6 x 12 mm deep	10.4	80	10	8.6	6.4	4.3
50	175	270	350	G 3/8	17	59	42	30	50	M8 x 16 mm deep	10.4	94	23	8.6	6.4	4.3
63	200	320	400	G 3/8	17	68.4	60	30	60	M8 x 16 mm deep	10.4	110	24	8.6	6.4	4.3

Piston-Ø	AH	AJ	AK	AL	AM	AN	AO	AP	AR	SA	SB	Ø X1	X2	Ø X3	X4	X5	Z
25	36	4.5	4.5	36	45	75	M4	59	15	11	3	4	4.4 + 0.2	4 H7	4.5	5.5	4 + 0.02
32	41	6.5	7.5	41	54	83.8	M5	69	15	11	4	4	4.4 + 0.2	4 H7	7	8	4 + 0.02
40	49	7.5	7.5	49	64	100	M6	79	18	12	4	6	6.4 + 0.2	6 H7	7	8	6 + 0.02
50	65	12.5	12.5	65	90	133	M8	112.5	25	17	5	-	6.4 + 0.2	6 H7	3	3	6 + 0.02
63	78	14	14	78	106	150	M8	134.5	26	17	5	-	6.4 + 0.2	6 H7	6.5	6.5	6 + 0.02