



Dimensions for series


ZX-Ø-SR

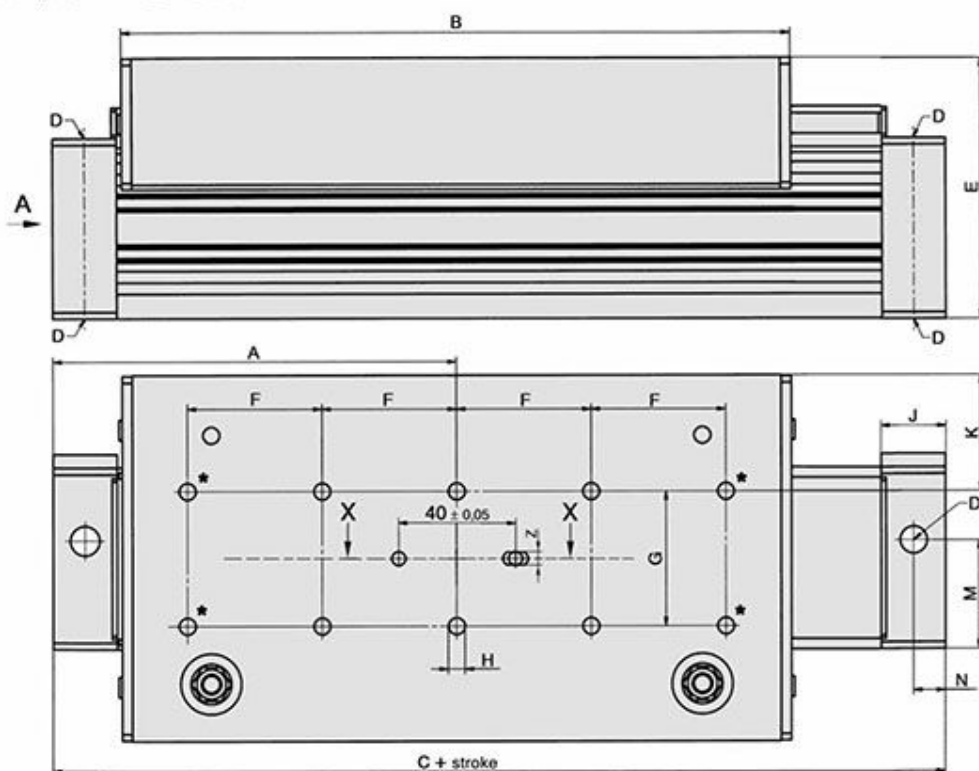


cross section B-B

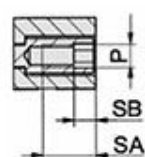

cross section X-X

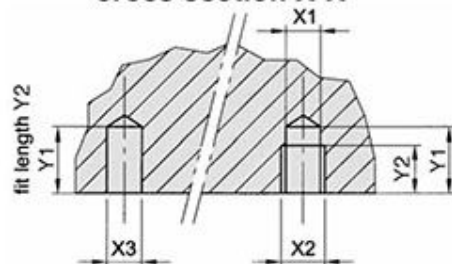

view A

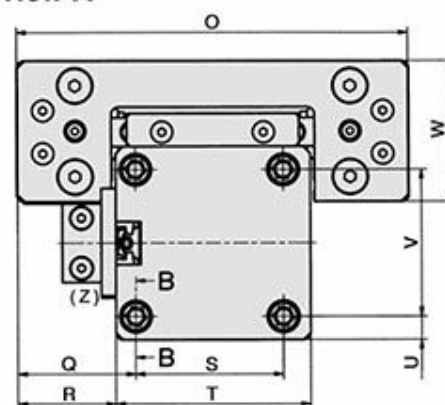

SA = Depth of thread
SB = Length of hex.

* = not for Ø 25 mm cylinder.

(Z) = Cushion set screw.

Drawing shows pressure supply type -01 for air connection on both ends.
Other types see page 9.156.

Piston-Ø	A	B	C	D	E	F	G	H	J	K	M	N	O	P
25	100	160	200	G 1/8	68.2	40	40	M5-7.5 mm deep	19	28.5	25	9.5	97	M4
32	120	201	240	G 1/8	78	40	40	M6-9 mm deep	19	34.5	32.3	9.5	108.8	M5
40	150	252	300	G 1/4	90.5	55	55	M6-12 mm deep	23	45	38.2	11.5	145	M6
50	175	270	350	G 3/8	120	55	55	M8-15 mm deep	30	54.5	59	17	164	M8
63	200	320	400	G 3/8	137	70	70	M8-17 mm deep	30	55	68.4	17	180	M8

Piston-Ø	Q	R	S	T	U	V	W	SA	SB	Ø X1	X2	Ø X3	Y1	Y2	Z
25	30.5	26	36	45	4.5	36	34.2	11	3	4	4.4 + 0.2	4 H7	8	7	4 + 0.02
32	32.9	27.4	41	54	6.5	41	39.5	11	4	4	4.4 + 0.2	4 H7	8	7	4 + 0.02
40	48	40.5	49	64	7.5	49	47	12	4	6	6.4 + 0.2	6 H7	8	7	6 + 0.02
50	49	36.5	65	90	12.5	65	51.5	17	5	6	6.4 + 0.2	6 H7	3.5	3	6 + 0.02
63	51	37	78	106	14	78	60.5	17	5	6	6.4 + 0.2	6 H7	7	6.5	6 + 0.02